

**Immediate Action Required**



## Products

**3M™ Scott™ E-Z Flo and E-Z Flo+ Mask-Mounted Regulators (MMR)**

**Manufacturing Dates: March 2022 – January 2023**



3M Personal Safety Division is issuing a “Stop Use and Inspect” for the 3M™ Scott™ E-Z Flo and E-Z Flo+ Mask-Mounted Regulators (MMR) manufactured between March 2022 and January 2023. 3M™ Scott™ E-Z Flo and E-Z Flo+ MMR are safe to use once the instructions in this notice are carried out.

Subsequent to the issuance of [User Safety Notice SN122022](#) in December 2022, and [User Safety Notice SN030623](#) in March 2023, 3M Scott Fire & Safety was made aware of an additional of E-Z Flo+ MMR having shipped from our factory with missing mounting latch screws. This unit was manufactured outside the dates indicated in the original Notices. The expanded date range we have identified for inspection includes all E-Z Flo and E-Z Flo+ regulators manufactured between March 2022 through January 2023 inclusive. Although we are confident from our inspections that this date range covers all potential instances of missing screws, we encourage inspection of all units in your fleet as per our User Instructions and Operation and Maintenance manuals prior to each use.

## Instructions for Users

Upon receipt of this notice, please perform the inspection whose instructions are detailed on Page 1, Figure 2 of the original [Notice SN122022](#) and as shown in Figure 1 below.

Figure 1: Cover Screen Location/Screws Missing versus Cover Screws Installed



If you identify one or more units within the date range of this notice, **please visually inspect them to ensure the presence of the mounting screws as shown**. If after inspection, it is discovered that an MMR is missing the mounting latch screws, take the MMR out of service and contact your 3M Scott Fire & Safety Authorized Service Center to complete the repairs required. Please note that it is unlikely a fielded SCBA, having been placed in service and previously inspected, would have missing screws.

## Instructions for Distributors

Upon receipt of this Notice, immediately forward this Notice to any of your customers who have purchased affected products from you and provide any assistance requested by your customers to complete the inspection process.

We apologize for any inconvenience caused. If you have any additional questions about this Notice please contact your 3M Scott Authorized Service Center, or 3M Scott Technical Support so that a service professional can assist you in completion of the Notice. 3M Scott Technical Support can be contacted at 1-800-247-7257, or [scotttechsupport@3m.com](mailto:scotttechsupport@3m.com), or through the web at [www.3M.com/ScottFire](http://www.3M.com/ScottFire).



### Personal Safety Division

4320 Goldmine Road  
Monroe, NC 28110

### In United States of America or Canada

Technical Service 1-800-247-7257  
Customer Service 1-800-247-7257  
[3M.com/ScottFire](http://3M.com/ScottFire)

© 3M 2024. All rights reserved.

3M and Scott are trademarks of 3M Company and its affiliates, used under license in Canada.

3M PSD products are occupational use only.

**Action immédiate requise**



## Produits

Régulateurs montés sur masque (MMR) 3M<sup>MC</sup> Scott<sup>MC</sup> E-Z Flo et E-Z Flo+

Dates de fabrication : Mars 2022 à janvier 2023




La Division de la sécurité personnelle de 3M émet un avis d'arrêt d'utilisation et d'inspection pour les régulateurs montés sur masque (MMR) 3M<sup>MC</sup> Scott<sup>MC</sup> E-Z Flo et E-Z Flo+ fabriqués entre le mois de mars 2022 et le mois de janvier 2023. Les MMR 3M<sup>MC</sup> Scott<sup>MC</sup> E-Z Flo et E-Z Flo+ pourront être utilisés en toute sécurité une fois que les instructions contenues dans cet avis auront été suivies.

Suite à la publication de l'[avis de sécurité SN122022](#) en décembre 2022 et de l'[avis de sécurité SN030623](#) en mars 2023, 3M Scott Fire & Safety a été informée qu'une unité supplémentaire de MMR E-Z Flo+ avait été expédiée de notre usine avec des vis de verrouillage de montage manquantes. Cet appareil a été fabriqué en dehors des dates indiquées dans les avis originaux. La plage de dates élargie que nous avons retenue pour l'inspection comprend tous les régulateurs E-Z Flo et E-Z Flo+ fabriqués entre le mois de mars 2022 et le mois de janvier 2023 inclus. Bien que nous soyons confiants, d'après nos inspections, que cette plage de dates couvre tous les cas potentiels où des vis sont manquantes, nous encourageons l'inspection de toutes les unités de votre parc conformément à nos directives d'utilisation et à nos manuels d'utilisation et d'entretien avant chaque utilisation.

## Directives pour les utilisateurs

Dès réception de cet avis, veuillez procéder à l'inspection conformément aux instructions détaillées à la page 1, figure 2 de l'[avis SN122022](#) original et à la figure 1 ci-dessous.

Figure 1: Emplacement de l'écran de couverture : Vis manquantes ou vis de couvercle installées

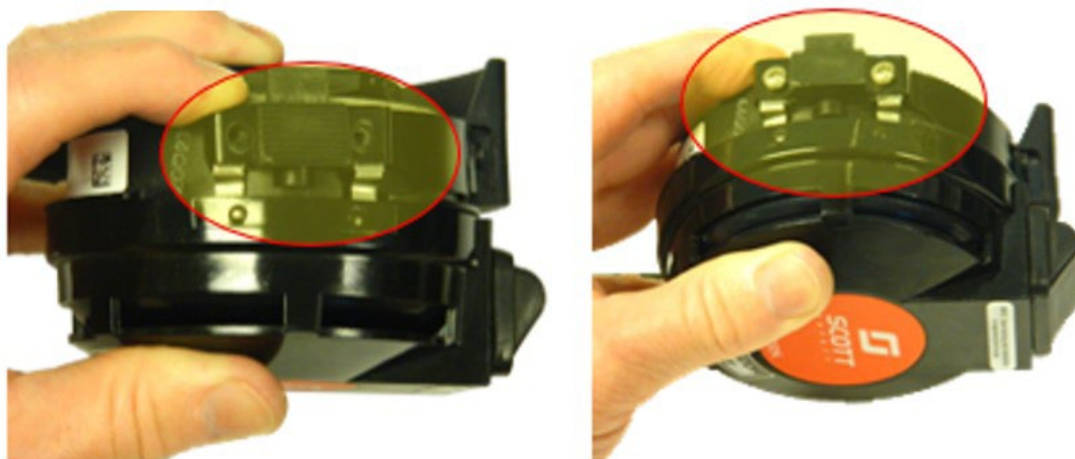

Si vous trouvez un ou plusieurs appareils dans la plage de dates mentionnée dans le présent avis, **veuillez les inspecter visuellement afin de vous assurer de la présence des vis de montage comme indiqué**. Si, après inspection, il s'avère qu'un MMR ne comporte pas les vis du verrou de montage, retirez le MMR du service et communiquez avec votre centre de service autorisé 3M Scott Fire & Safety pour effectuer les réparations nécessaires. Veuillez noter qu'il est peu probable qu'un APRA mis en service et précédemment inspecté présente des vis manquantes.

## Instructions pour les distributeurs

Dès réception de cet avis, transmettez-le immédiatement à tous vos clients qui vous ont acheté les produits concernés et fournissez à vos clients toute l'assistance qu'ils vous demanderont pour mener à bien la procédure d'inspection.

Nous nous excusons pour tout inconvénient causé. Si vous avez d'autres questions au sujet de cet avis, veuillez communiquer avec votre centre de service autorisé 3M Scott ou le soutien technique 3M Scott. Un professionnel des services pourra vous aider. Vous pouvez communiquer avec le soutien technique 3M Scott en composant le 1 800 247-7257, en écrivant à l'adresse [scotttechsupport@3m.com](mailto:scotttechsupport@3m.com) ou sur le site Web au [www.3M.com/ScottFire](http://www.3M.com/ScottFire).



### Personal Safety Division

4320 Goldmine Road  
Monroe, NC 28110

### In United States of America or Canada

Technical Service 1-800-247-7257  
Customer Service 1-800-247-7257  
[3M.com/ScottFire](http://3M.com/ScottFire)

© 3M 2024. All rights reserved.

3M and Scott are trademarks of 3M Company and its affiliates, used under license in Canada.

3M PSD products are occupational use only.