

F2 Arc Flash Adjustable Web Shock-Absorbing Lanyard

Product: Select CSA and ANSI 3M™ DBI-SALA® EZ-Stop™ F2 Arc Flash Adjustable Web Shock-Absorbing Lanyard

Impacted Manufacturing Dates: 8/24/2023 – 8/27/2024

Select CSA and ANSI 3M™ DBI-SALA® EZ-Stop™ F2 Arc Flash Adjustable Web Shock-Absorbing Lanyard




As part of 3M's ongoing commitment to delivering high quality products, we are notifying our customers of the following information related to a supplied raw material issue related to a small number of arc flash loop keepers. 3M has identified an issue on select 3M™ DBI-SALA® EZ-Stop™ F2 Arc Flash Adjustable Web Shock-Absorbing Lanyard. The potentially affected materials were produced between August 24, 2023 and August 27, 2024. 3M has determined that in the event of an arc flash, **these loop keepers may not extinguish flame which could expose the worker to an injury.** There are no current reports of injuries or accidents related to these materials.

Due to this, we are sending out this product advisory notice. Any affected products should be removed from service immediately so the inspection can be performed. Failure to read and follow all instructions associated with this Notice may result in an injury of a user. Instructions for appropriate next steps are below, see the appendix for a complete list of models impacted by this product advisory notice.

End Users:

Step 1: Locate the model number and manufacture date on the device information label (see Figure 1). If your device model number is listed in the appendix and it was manufactured between August 24, 2023 and August 27, 2024 proceed to step 2. Devices with model numbers not listed in the appendix or not built during the affected time range are not impacted by this product advisory and may be returned to service.

Figure 1: Manufacture date and model number on device information label

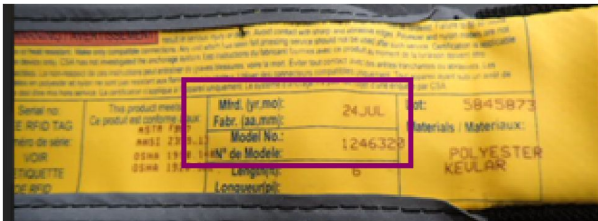

Step 2: Find and inspect the loop keeper (shown in Figure 2): If the elastic loop keeper band has pattern weaving like the image (shown in Figure 3), the product is affected, proceed to Step 3. If your pattern weave is the same as Figure 4 or has the plastic clip shown in Figure 4, your product is not affected, and you can continue use provided it passes your pre-use inspection as listed in the IFU.

Figure 2:

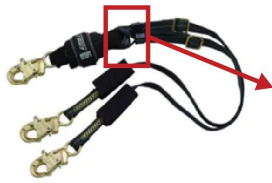


Figure 3:



Figure 4:



Step 3: Remove elastic loop taking care not to damage other lanyard material or contact your distributor to return your product for credit.

Distributors:

Upon receipt of this Product Advisory, please contact your 3M Technical Services for a listing of the impacted products sold to you. If you are located in US and Canada and have any of the affected devices in stock, please contact Customer Issue Resolution (3msupport.crcsibgreturns@mmm.com or 1-855-724-4408, option #2) to submit a Return Material Authorization. If you are located international (outside of US and Canada), contact your Customer Service Representative. Please immediately forward this Product Advisory to any of your customers who have purchased affected product from you and provide any assistance requested by your customers to complete the process.

If you have any questions, please contact our Technical Service Team:

US: Call 1-800-328-6146 or email 3Mfallprotection@mmm.com

Canada: Call 1-800-387-7484 or email 3Mfallprotection-ca@mmm.com

Brazil: Call 0800-013-2333 or email falecoma3m@mmm.com

Mexico: Call 01 800 120 3636 or email 3msaludocupacional@mmm.com

Europe, Middle East, Africa: Call +33 04 97 10 00 10 or email informationfallprotection@mmm.com

United Kingdom: Call 0870 60800 60 or visit www.3M.co.uk/construction

Slovakia: Call +421 (0)47 00 330 or email informationfallprotection@mmm.com

Australia and New Zealand: Call 1800-245-002 (AUS), 088 212 505 (NZ) or email 3msafteyaucs@mmm.com

Singapore: Call 1-800-387-7484 or email 3Mfallprotection-ca@mmm.com

China: Call +86 21 62753535 or email 3Mfallprotection-CN@mmm.com

Korea: Call +82-2-3771-4977 or email 3msupport.kr@mmm.com

Japan: Call +81-570-011-321 or email psd.jp@mmm.com

Appendix

Table 1: List of Models

| 3M ID | Model Number | Description |
|------------|--------------|--|
| 7012817268 | 1246317 | 3M™ DBI-SALA® EZ-Stop™ F2 Arc Flash Adjustable Web Shock-Absorbing Lanyard 1246317, Kevlar® Fiber, 6 ft |
| 7100318478 | 1246320 | 3M™DBI-SALA® EZ-Stop™ F2 Arc Flash 100% Tie-Off Adjustable Web Shock-Absorbing Lanyard 1246320, Kevlar® Fiber, 6 ft |
| 7012817282 | 1246352 | 3M™ DBI-SALA® EZ-Stop™ F2 Arc Flash 100% Tie-Off Adjustable Web Shock-Absorbing Lanyard 1246352, Kevlar® Fiber, 6 ft |
| 7012817270 | 1246318 | 3M™ DBI-SALA® EZ-Stop™ F2 Arc Flash Adjustable Web Shock-Absorbing Lanyard 1246318, Kevlar® Fiber, 6 ft |
| 7012817272 | 1246319 | 3M™ DBI-SALA® EZ-Stop™ F2 Arc Flash Adjustable Web Shock-Absorbing Lanyard 1246319, Kevlar® Fiber, 6 ft |
| 7012817275 | 1246321 | 3M™ DBI-SALA® EZ-Stop™ F2 Arc Flash 100% Tie-off Adjustable Web Shock-absorbing Lanyard 1246321, Kevlar® Fiber, 6 Ft |
| 7012817276 | 1246322 | 3M™ DBI-SALA® EZ-Stop™ F2 Arc Flash 100% Tie-Off Adjustable Web Shock-Absorbing Lanyard 1246322, Kevlar® Fiber, 6 ft |

| 3M ID | Model Number | Description |
|------------|--------------|---|
| 7012817299 | 1246458 | 3M™ DBI-SALA® EZ-Stop™ F2 Arc Flash Adjustable Web Shock-Absorbing Lanyard 1246458, Kevlar® Fiber, 6 ft |
| 7012817269 | 1246317C | 3M™ DBI-SALA® EZ-Stop™ F2 Arc Flash Adjustable Web Shock-Absorbing Lanyard 1246317C, Kevlar® Fiber, 6 ft |
| 7012817271 | 1246318C | 3M™ DBI-SALA® EZ-Stop™ F2 Arc Flash Adjustable Web Shock-Absorbing Lanyard 1246318C, Kevlar® Fiber, 6 ft |
| 7012817274 | 1246320C | 3M™ DBI-SALA® EZ-Stop™ F2 Arc Flash 100% Tie-Off Adjustable Web Shock-Absorbing Lanyard 1246320C, Kevlar® Fiber, 6 ft |
| 7012817283 | 1246352C | 3M™ DBI-SALA® EZ-Stop™ F2 Arc Flash 100% Tie-Off Adjustable Web Shock-Absorbing Lanyard 1246352C, Kevlar® Fiber, 6 ft |

3M remains committed to providing quality products and services to our customers. We apologize for any inconvenience that this situation may cause you. We appreciate your continued support of 3M Fall Protection products and services.



3M Personal Safety Division
3M Fall Protection Business

3833 SALA Way
Red Wing, MN 55066-5005

3M PSD products are occupational use only.

3M Canada

3M Fall Protection Business
600 Edwards Blvd, Unit #2
Mississauga, ON L5T 2V7

In United States of America

Technical Service: 1-800-328-6146
Customer Service: 1-800-328-1667
3M.com/workersafety

In Canada

Technical Service: 1-800-267-4414
Customer Service: 1-800-364-3577
3M.ca/Safety

© 3M, 2025. All Rights Reserved.
3M, DBI-SALA, and EZ-Stop are trademarks of 3M.

Used under license in Canada. All other trademarks are property of their respective owners. Please recycle.